

Work Order ID 72336

Friday, July 22, 2011 12:32:46 PM

**U/R**

Page 1

Item ID: D350-748-141TRN

Accept



Setup Start



Revision ID: U/R

Item Name: Crosstube Turning Detail

Stop



Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan:

Date: 1-07-22 Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D350-748-141	F U/R OK 11.09.22								
100		0.00							
	MORI SEIKI CNC LATHE LARGE								
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Fill tube with sand & install plugs on both ends as per Folio FA648 2-Turn first side as per Folio FA648 3- File transition lines smooth.								
110		0.00							
	QC1- Inspect dimensions to dimension sheet								
QC	Memo	0.00							
Quality Control									
120		0.00							
	MORI SEIKI CNC LATHE LARGE								
Mori Seiki	Memo	0.00							
Mori Seiki CNC Lathe Large	1-Turn second side as per Folio FA648 2- File transition lines smooth. 3-Scribe Part & Batch as per Dwg D350-748-141								

Dart Aerospace Ltd

W/O: 12336		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: D350-748-141TRN PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
11.08.22	100	G.D. is below tolerance in two locations by gross R.C. Program MOD's	CP 11/08/22 PS/042	Acceptable. Less than allowable damage cleanup.	APB 11/08/22	S 11/08/22	CP 11.08.22 PS/042	S 11/08/22

NOTE: Date & initial all entries

Work Order ID 72336

Friday, July 22, 2011 12:32:46 PM

Page 2

Item ID: D350-748-141TRN

Accept

Setup Start

Revision ID: U/R

Stop

Item Name: Crosstube Turning Detail

Start Date: 7/22/2011 Start Qty: 1.00

Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

130

QC1- Inspect dimensions to dimension sheet

0.00



QC

Memo

0.00

Quality Control

140

QC8- Inspect parts - second check

0.00



QC

Memo

0.00

Quality Control

150

Large Fab

0.00



Crosstubes

Memo

0.00

Crosstubes

Grind machining marks

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Friday, July 22, 2011 12:32:46 PM

Accept



Setup Start

Stop

**Cust Item ID:**

Customer:

Reference:

Run Start

Stop

**Insp.
Stamp**

0.00

[illegible]

Memo

0.00

Issue P/O: 14727
Heat Treat to min 180 KSI As per Dwg D350-748-141
(MIL-T-6736 OR AMS 2759-1C)
Sand Blast tube after Heat Treat
Possible Supplier: Vac Aero
Ensure Certificate of Conformity is attached

CL 11/08/24 ①

0.00

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

Memo

0.00

Ensure certificate of conformaty is attached

Page 26 (1)

0.00

[illegible]

Memo

0.00

Quality Control

Sulorbe

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 72336

Friday, July 22, 2011 12:32:46 PM



Page 4

Item ID: D350-748-141TRN

Accept



Setup Start



Revision ID: U/R

Stop



Item Name: Crosstube Turning Detail

Start Date: 7/22/2011 Start Qty: 1.00



Cust Item ID:

Required Date: 7/29/2011 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start



QC:

Date:

SPC (Y/N):

Date:

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190



Packaging

Packaging

0.00

Memo

0.00

Identify and stock in kanban rack
Location: Back Hall

min 11/09/26

200



QC

QC21- Final Inspection - Work Order Release

0.00

Memo

0.00

Quality Control

11/9/27

MUF

11-09-27

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR: Yes No** **DQA:** _____ **Date:** _____
Resolution: _____ **Disposition:** _____ **QA: N/C Closed:** _____ **Date:** _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

-Picklist Print

Friday, July 22, 2011 12:32:53 PM

Page 1

Work Order ID: 72336



Parent Item: D350-748-141TRN



Parent Item Name: Crosstube Turning Detail



Start Date: 7/22/2011

Required Date: 7/29/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD verified by:ec
IPP Rev B Removed polish 08.04.02 EC verified by : DD
IPP Rev C Remove LPS-3 08.06.23 EC verified by DD IPP Rev C
11.02.24 as per dwg rev.F DD verf: JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6015-125 		Manufactured	No			110	Each	43.0000	1	1			
Crosstube Material													

Location

Loc Qty

Loc Code

HALL

43

61380

43

1 man.L 11/08/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	72336
Description: Crosstube Assembly (AS350/355 High Fwd)	Part Number:	D350-748-141
Inspection Dwg: D350-748-141 Rev: E		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.238"	✓		Mic.	CNC-04
	2.180	+0.005/-0.000	2.180"	✓		"	"
	2.180	+0.005/-0.000	2.181"	✓		"	"
	2.237	+0.005/-0.000	2.238"	✓		"	"
	2.272	+0.005/-0.000	2.273"	✓		"	"
	2.306	+0.005/-0.000	2.307"	✓		"	"
	2.339	+0.005/-0.000	2.337"	✓		"	"
	2.339	+0.005/-0.000	2.346"	✓		"	"
	0.062	+/-0.010	.062	✓		Vern.	JF-01
	4.26	+/-0.030	4.240"	✓		"	"
	R0.063	+/-0.010	.063	✓		R.G.	Ref.
	R0.50	+/-0.030	R0.500"	✓		"	"
SIDE B	2.240	+0.005/-0.000	2.242"	✓		Mic.	CNC-04
	2.180	+0.005/-0.000	2.182"	✓		"	"
	2.180	+0.005/-0.000	2.183"	✓		"	"
	2.237	+0.005/-0.000	2.240"	✓		"	"
	2.272	+0.005/-0.000	2.275"	✓		"	"
	2.306	+0.005/-0.000	2.308"	✓		"	"
	2.339	+0.005/-0.000	2.341"	✓		"	"
	2.339	+0.005/-0.000	2.346"	✓		"	"
	0.062	+/-0.010	.062	✓		Vern.	J.F-01
	4.26	+/-0.030	4.255"	✓		"	"
	R0.063	+/-0.010	.063	✓		R.G.	Ref.
	R0.50	+/-0.030	R0.500"	✓		"	"
	110.27	+/-0.060	110.26	✓		tape	mm.L-02

Measured by: JMM.V/018	Audited by: J.A	Preliminary Approval:
Date: 11/08/16	Date: 11/08/22	Date:

Rev	Date	Change	Revised by	Approved
A	06.11.09	New Issue (P/O D350-748-101)	KJ/JLM	
B	07.10.24	Dwg Rev updated	KJ/EC/DD	
C	11.01.20	Dwg Rev updated	KJ	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Item	Qty -141	Part Number	Description
1	X	D350-748-141	CROSSTUBE ASSEMBLY (AS 350/355 HI FWD)
2	1	D6015-125	CROSSTUBE (OR D6017-115)
3	2	D3502-1	SUPPORT
4	2	D2856-400-710	ABRASION STRIP
5	1	AELS-1032-225	INSERT
6	1	NAS1149D0363J	WASHER (OR AN960JD10)
7	2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
8	1	MS27039-1-10	SCREW

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6015-125 OR D6017-115
FINISHED LENGTH = 110.270±0.06
- 2) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: DART PART NUMBER "D350-748-141" AND BATCH NUMBER ON INSIDE OF CUFF
PER DART QSI 044 6.4 (VIBRATING STYLUS)
- 7) WEIGHT: 30.45 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE, EXCEPT FOR Ø0.297 HOLE.
- 9) BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 11) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING. ACCEPTABLE TO
VERIFY TENSILE STRENGTH BY HARDNESS TEST PER ASTM E18 TO 40-45 HRC.
- 12) INSTALL D2856-400-710 ABRASION STRIPS WITH A GAP ON BOTTOM SIDE OF CROSSTUBE,
CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 13) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES,
NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY.
CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE
MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO
CRACKING/CHIPPING/GROOVES.
- 14) TORQUE CLAMPS 60 TO 80 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT
NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 15) MAX TWIST AFTER BENDING: WITH XTUBE LAYED FLAT ON SURFACE, THE DIFFERENCE BETWEEN
CUFF HEIGHTS FROM THE SURFACE MAY BE NO LARGER THAN 0.25 (ZN C1-3).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 72334

11-07-22

UNDER REVIEW

11.07.12

RELEASED
2011-01-18

F	ADD HRC TEST OPTION (B8-1) PER PAR 09-040, ADD TWIST LIMIT (A8-1, C1-3), ADD D6015-125 OPTION (C8-1), STOCK DIM NOW MACHINED (D1-4)	CP	10.11.23
E	REVISE GENERAL NOTES; UPDATE TO CURRENT ADD STANDARDS; RELOCATED FLAG #6 PER PAR 08-048 (ZN A6-3); TOLERANCES (ZN C6-3, D1-3)	RF	09.09.30
D	MAG. PARTICLE AND CAD PLATE AS MFD.	CP	06.10.31
C	ADD CAD PLATING	CP	06.08.14
B	ADD D6017-115 & PRIME AND PAINT	CP	06.06.30
A	NEW ISSUE	CP	06.03.31
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>qp</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	<i>qp</i>		
CHECKED	<i>qp</i>	DRAWING NO.	REV. F
MFG. APPR.	<i>qp</i>	D350-748-141	SHEET 1 OF 4
APPROVED	<i>qp</i>	TITLE	SCALE
DE APPR.	<i>qp</i>	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	10.11.23	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

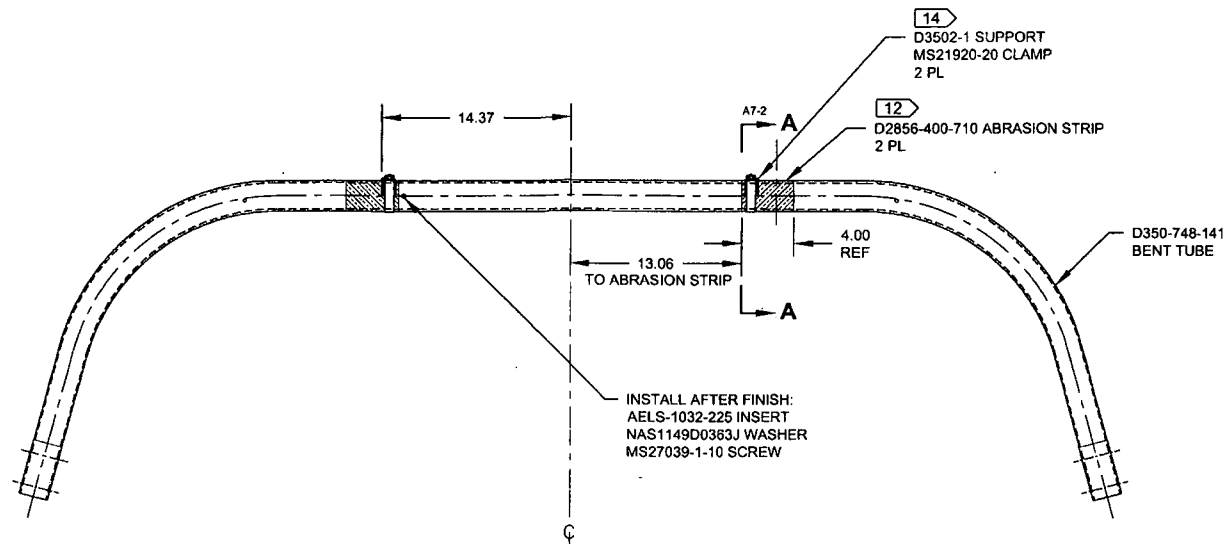

**D350-748-141
ASSEMBLY DETAIL**

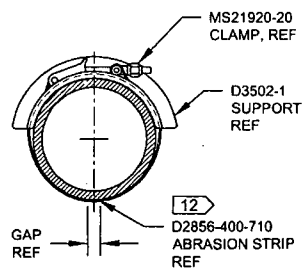

SECTION A-A D4-2
SCALE 4X

DESIGN	99	DART AEROSPACE LTD	
DRAWN	99	HAWKESBURY, ONTARIO, CANADA	
CHECKED	99	DRAWING NO.	REV. F
MFG. APPR.	99	D350-748-141	SHEET 2 OF 4
APPROVED	99	TITLE	SCALE
DE APPR.	99	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	10.11.23	<small>COPYRIGHT © 2008 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

UNDER REVIEW

11.07.11

RELEASED
2011-01-18

wb 72336

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

8 7 6 5 4 3 2 1

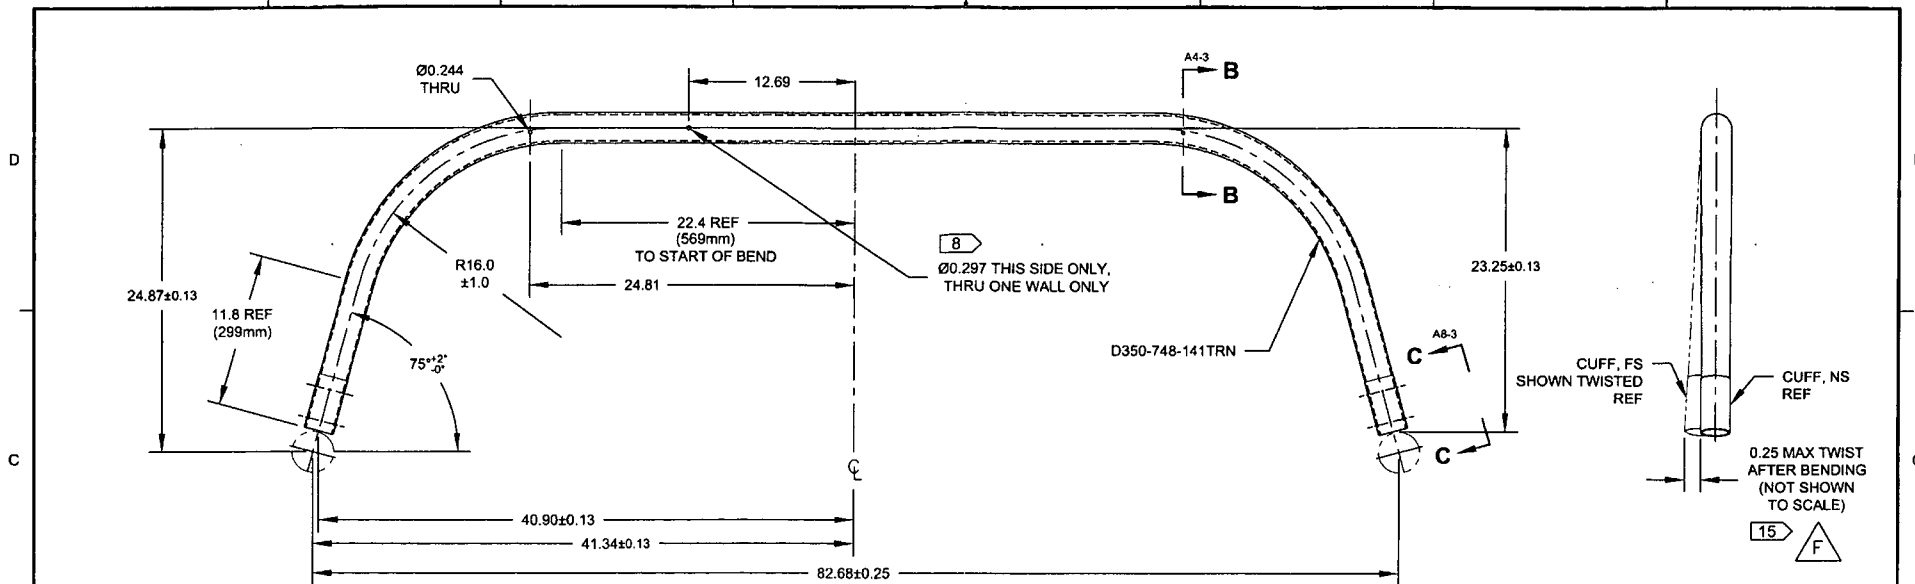

D350-748-141
BENDING AND DRILLING DETAIL 10

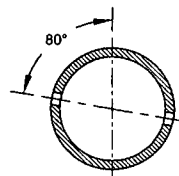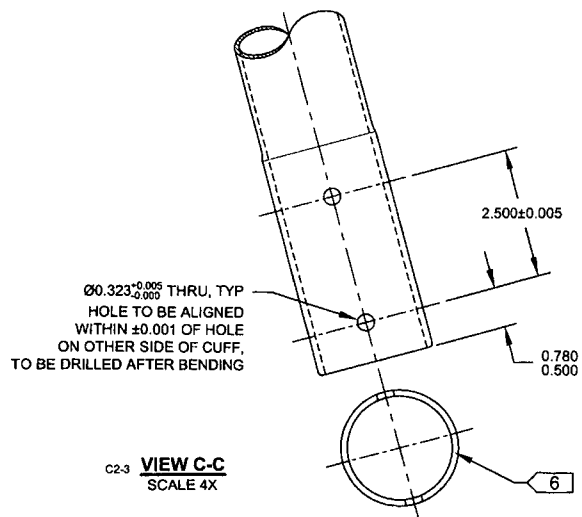

SECTION B-B D3-3
SCALE 4X

alt 72336

UNDER REVIEW
11.37.12

RELEASED
2011-01-18

DESIGN	97	DART AEROSPACE LTD	
DRAWN	97	HAWKESBURY, ONTARIO, CANADA	
CHECKED	97	DRAWING NO.	REV. F
MFG. APPR.	97	D350-748-141	SHEET 3 OF 4
APPROVED	97	TITLE	SCALE
DE APPR.	97	CROSSTUBE (AS 350/355 HI FWD)	NTS
DATE	10.11.23	<small>COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

8 7 6 5 4 3 2 1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



VAC AERO
INTERNATIONAL INC.

RELEASE NOTE

GST No.: R105468102

OAK 133773-1



HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489



2009 WYECROFT ROAD, UNIT B
OAKVILLE, ONTARIO
CANADA L6L 6J4
TEL: (905) 827-7377 FAX: (905) 827-1380



QUEBEC DIVISION
7450 RUE VERITÉ STREET, ST. LAURENT, QUÉBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX: (514) 334-6269

09/22/2011

MM / DD / YYYY

PAGE: 1

1DAR01

BILL TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
09/22/2011		ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
P014727		NET 30 DAYS

PART No.	DESCRIPTION	UOM	QTY ORD	QTY SHPD	TEST RESULTS
D350-748	-141 CROSS TUBE	EA	12	12	
<p>Process Specifications: Procedure: 4353 HEAT TREATED TO 180 KSI MIN. PER AMS 2759-1E 100% HARDNESS CHECKED AS PER ASTM E-18 40/45 HRC MATERIAL: 4130</p> <p>LINE# 70650, 1 PC LINE# 72812, 1 PC LINE# 70652, 1 PC LINE# 72813, 1 PC LINE# 72334, 1 PC LINE# 72814, 1 PC LINE# 72335, 1 PC LINE# 72815, 1 PC LINE# 72336, 1 PC LINE# 72816, 1 PC LINE# 72337, 1 PC LINE# 72817, 1 PC</p> <p>100% HARDNESS TESTED 44-12 PG 44/45 HRC 2380/11</p> <p>VALO TCC 4353</p>					

I hereby certify that the material covered by this release note has been inspected and tested and conforms to all specifications relevant thereto in accordance with the conditions of the contract / or purchase order.

ON BEHALF OF VAC AERO INTERNATIONAL INC.



METAL TREATING INSTITUTE

Authorized Q.C. Inspector



VACUUM BRAZING · HEAT TREATING · SPECIAL PROCESSING · FURNACE EQUIPMENT
TURBINE COMPONENT OVERHAUL · PLASMA AND OTHER COATINGS